



GAI-TRONICS® CORPORATION
A HUBBELL COMPANY

Model 263 Isolation Barrier Unit

Confidentiality Notice

This manual is provided solely as an operational, installation, and maintenance guide and contains sensitive business and technical information that is confidential and proprietary to GAI-Tronics. GAI-Tronics retains all intellectual property and other rights in or to the information contained herein, and such information may only be used in connection with the operation of your GAI-Tronics product or system. This manual may not be disclosed in any form, in whole or in part, directly or indirectly, to any third party.

General Information

GAI-Tronics Corporation offers intrinsically-safe (I.S.) telephones and isolation barrier units (IBU), which conform to all pertinent requirements in the USA and Canada. For convenience, a telephone and an IBU can be purchased together under a single model number: Model 261-001 for indoor use, and Model 271-001 for outdoors.

However, for rack-mount configurations or special applications, the telephones and IBUs can be purchased separately:

- Model 262-001 Indoor I.S. Phone
- Model 272-001 Outdoor I.S. Phone
- Model 263 Isolation Barrier Unit

The I.S. telephones are designed to be installed in all hazardous areas. The IBU or rack-mount card unit is placed in a non-hazardous area up to one mile from the phone, limiting the energy levels going to the hazardous area to conform to intrinsically-safe requirements.

The Model 263 Isolation Barrier Unit is constructed of durable glass-reinforced polyester, which is highly resistant to chemicals and weather, and is rated Type 3R (rainproof).

Installation

Installation Guidelines

When installing any GAI-Tronics telephone equipment, please adhere to the following guidelines to ensure the safety of all personnel:

- NEVER install telephone wiring during a lightning storm.
- **Install a UL Listed lightning arrester** on any phone installed where the phone or phone cable is at risk of being exposed to lightning strikes. The lightning arrester must be installed as close to the phone as possible to maximize the protection. The lightning arrester must not be installed within the enclosure supplied with the phone.
- NEVER install telephone jacks in wet locations unless the jack is specifically designed for wet locations.
- NEVER touch uninsulated telephone wires or terminals unless the telephone line has been disconnected at the network interface.
- USE CAUTION when installing or modifying telephone lines.
- Install UL Listed telephone line suppressor (customer-supplied) on the telephone line.
- Use silicone sealant or equivalent around and inside all conduit entries

Installation of the IBU

The Model 263 Isolation Barrier Unit provides an intrinsically-safe circuit when connected in accordance with GAI-Tronics Pub. 42004-380, Control Drawing 73242. It must be installed in a non-hazardous location. See Figure 1 for a typical installation.

The Model 263 Isolation Barrier Unit interior includes a power switch selector, a ring pitch adjustment, and four troubleshooting LEDs. The IBU housing is composed of two modular subassemblies, the front panel and the rear enclosure assembly, for easy installation and wiring.

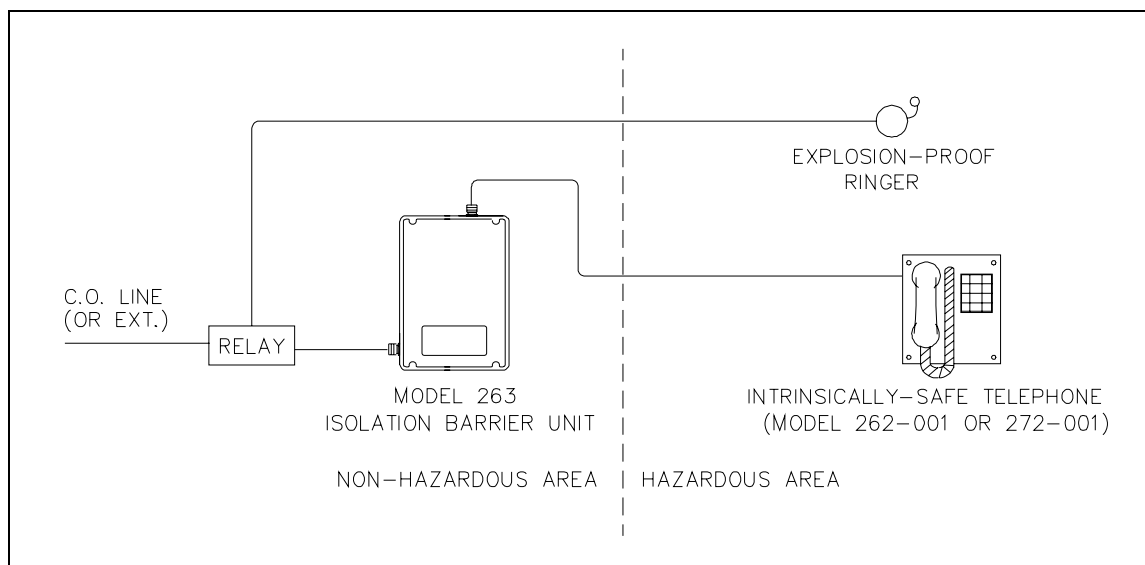


Figure 1. Typical intrinsically-safe installation

Wiring Requirements

Design Limits

In order to be *intrinsically safe*, energy and energy storage must be constrained to “safe” levels in hazardous area apparatus. Wiring inherently has capacitance formed by a dielectric material between two conductors. A buildup of this capacitance can form a surge of electricity, a dangerous situation in a hazardous area.

Intrinsically-safe telephones require cabling that will limit the amount of capacitance formed. The limitation on cable length was set by Underwriter’s Laboratory (UL) based on test results. This “worst case” cable available was found to have a capacitance of 60 picofarads/foot. Therefore, UL set the cable limitation at one mile, the length at which this worst-case cable capacitance level was still within acceptable bounds. Cable types with less capacitance have been specified to allow connection distances over one mile.

For example: GAI-Tronics Model 60059-001 and 60021-301 cables allow connection distances of up to 1.5 miles.

Shielded Cable

Where multiple I.S. telephone wires are routed together, shielded cable should be used. The use of shielded cable prevents cross-talk from occurring between multiple I.S. telephone circuits. The shield must be grounded to an I.S. ground and connected only at the IBU.

Wiring Guidelines/Control Drawing

The Model 263 provides an intrinsically-safe circuit when installed in accordance with GAI-Tronics Pub. 42004-380, Control Drawing 73242. In addition, the NEC and the CEC provide additional installation details that are recommended for safe installation.

General Wire Types					
	24 AWG	22 AWG	20 AWG	19 AWG	18 AWG
Maximum capacitance, C (picofarads/mile)	316,800 pF/mile				
Maximum resistance, R (ohms/mile)	271	171	107	85	67
*Ring signal loss, decibels (dB/mile)	-16	-12	-8	-6	-4

*Nominal ring signal is 98 dB @ 10 feet.

System Setup

GAI-Tronics recommends taking the following steps to ensure a safe and trouble-free installation:

1. Install the Model 263 Isolation Barrier Unit (IBU) and wire it completely, except for the hazardous area signal wires.

 **WARNING**  **The unit must be wired in accordance with Pub. 42004-380, Control Drawing 73242, to ensure intrinsic safety.**

2. Next, temporarily connect the I.S. telephone to the IBU with a short pair of conductors, and operate the unit by making a test phone call. If any problems are detected, see the Troubleshooting section.
3. Call the I.S. telephone from another telephone, and adjust the RING PITCH (located on the IBU) to the desired pitch. See Figure 2 for location.
4. Disconnect the I.S. telephone and install it in the intended permanent location.

 **WARNING**  **The unit must be wired in accordance with Pub. 42004-380, Control Drawing 73242, to ensure intrinsic safety.**

5. Make a call from the I.S. telephone. If any problems are detected, see the Troubleshooting section.

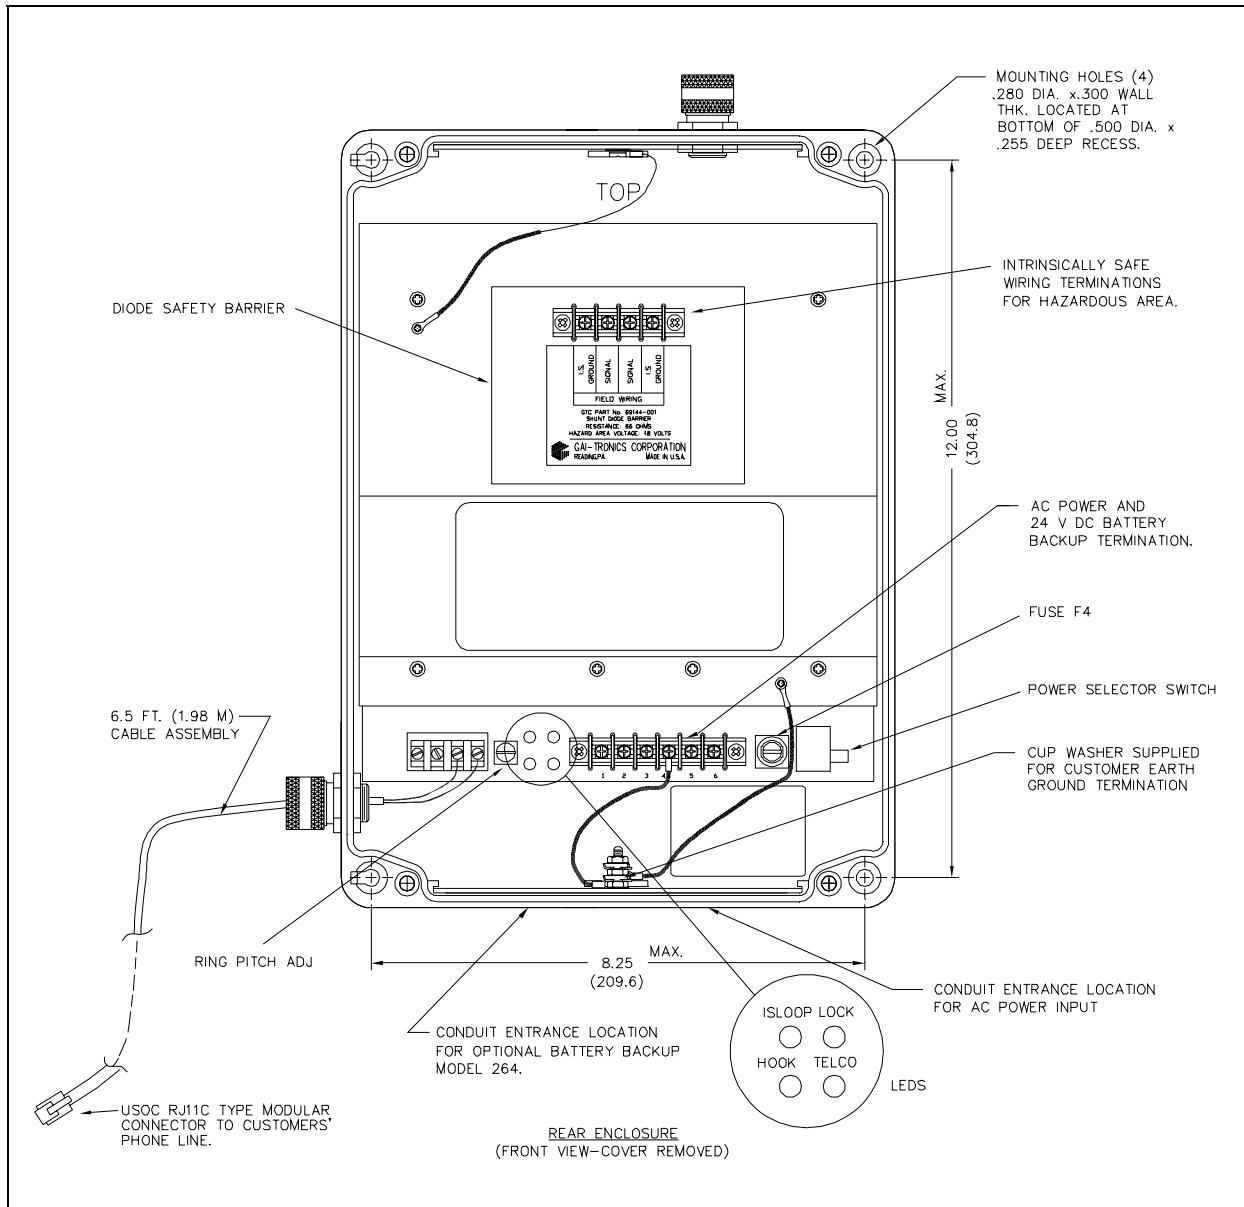


Figure 2. Rear of IBU enclosure with cover removed

Mounting

1. Remove the front panel by loosening the four front captive screws.
2. Refer to Figure 3. Determine which of the conduit locations is to be used. Drill spots have been provided for use with a chassis punch or hole saw. Using a hole saw is recommended.
3. One 0.280-inch diameter hole is located in each corner of the rear enclosure. Install the rear enclosure to a wall of an appropriate surface through the supplied mounting holes.
4. Refer to Pub. 42004-380, Control Drawing 73242, for wiring details.
NOTE: Telephone system wire must be connected to the Isolation Barrier Unit only and not directly to the I.S. telephone. Battery backup connection is not required for operation of the Model 262-001 and 272-001 I.S. Phones. If battery backup is desired, please consult the factory for specifications.
5. Apply power and test telephone operation.
6. Refer to the Troubleshooting section if problems are detected.

When proper operation has been verified, replace the cover and secure it by tightening the four captive screws.

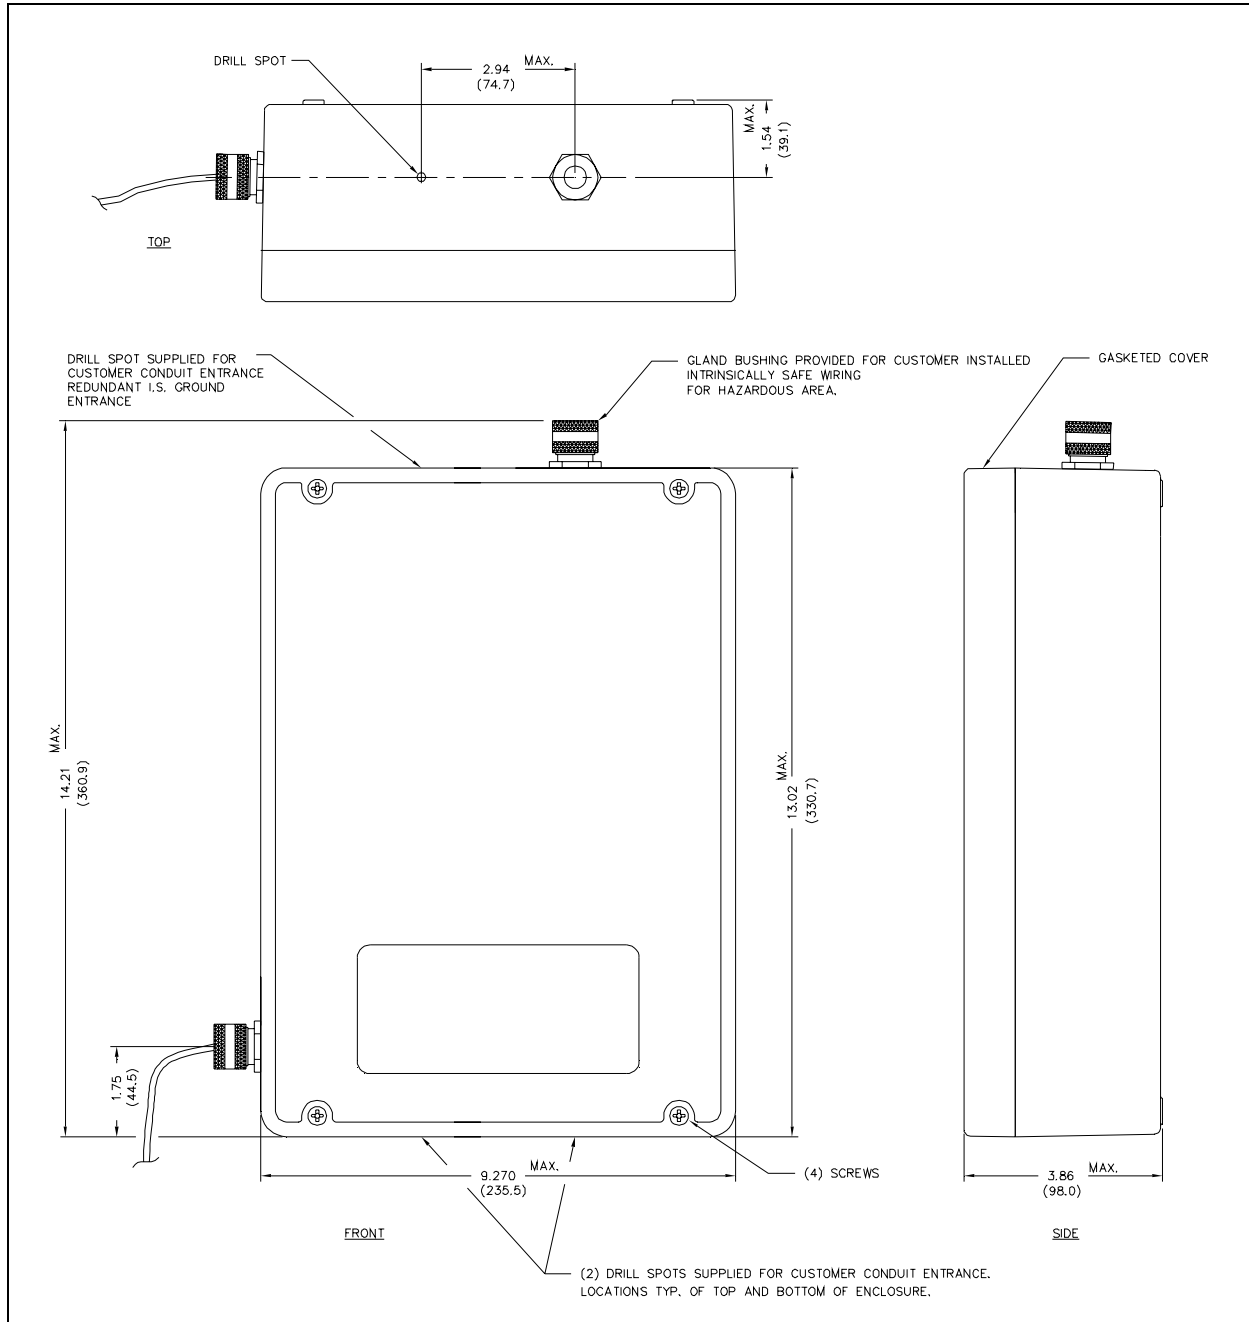


Figure 3. Model 263 Isolation Barrier Unit dimensions

Operation

The Model 263 Isolation Barrier Unit requires no operator intervention for routine functions.

Maintenance

This section includes two troubleshooting charts designed to quickly pinpoint the source of problems.

Troubleshooting

NOTE: It may be advantageous to temporarily connect an I.S. telephone panel directly to the output terminals of the Model 263 IBU when troubleshooting. Then, using the charts below, the cause of the problem should be more easily determined.

Non-Equipment Related Problems

Problem	Solution								
The I.S. phone is inactive with no lights on the IBU when the phone is off-hook.	<ol style="list-style-type: none"> 1. Check the ac power to the Model 263 IBU. 2. Check the ac fuse F4 at the Model 263 IBU. 3. Ensure there is no wiring open at the I.S. phone. 								
The I.S. phone has no dial tone.	<ol style="list-style-type: none"> 1. If the I.S. phone has a wiring short, the IBU lights will be lit in the following pattern: ● = On, ○ = Off <table style="margin-left: 40px;"> <tr> <td>ISLOOP</td> <td>LOCK</td> </tr> <tr> <td style="text-align: center;">●</td> <td style="text-align: center;">○</td> </tr> <tr> <td>HOOK</td> <td>TELCO</td> </tr> <tr> <td style="text-align: center;">○</td> <td style="text-align: center;">○</td> </tr> </table> 	ISLOOP	LOCK	●	○	HOOK	TELCO	○	○
	ISLOOP	LOCK							
●	○								
HOOK	TELCO								
○	○								
<ol style="list-style-type: none"> 2. If the TELCO line has an open, the IBU lights will be lit in the following pattern: : ● = On, ○ = Off <table style="margin-left: 40px;"> <tr> <td>ISLOOP</td> <td>LOCK</td> </tr> <tr> <td style="text-align: center;">●</td> <td style="text-align: center;">●</td> </tr> <tr> <td>HOOK</td> <td>TELCO</td> </tr> <tr> <td style="text-align: center;">●</td> <td style="text-align: center;">○</td> </tr> </table> 	ISLOOP	LOCK	●	●	HOOK	TELCO	●	○	
ISLOOP	LOCK								
●	●								
HOOK	TELCO								
●	○								
The lights on the IBU flash randomly.	The I.S. phone has an intermittent wiring short. The short may be between the conductors or either/both conductor(s) to ground/shield.								

Equipment-Related Problems

Problem	Solution
There is no incoming ring tone.	<ol style="list-style-type: none"> 1. Check the I.S. telephone panel. 2. Check the Model 263 IBU.
No receiver audio, no sidetone, and cannot hear touch tones when pressed.	<ol style="list-style-type: none"> 1. Check the I.S. telephone panel. 2. Check the Model 263 IBU. 3. There may be a wiring open or a short in the connecting cable.
Cannot dial out, but can hear touch tones when pressed.	<ol style="list-style-type: none"> 1. Check the Model 263 IBU. 2. There is no TELCO connection or it is faulty.
I.S. phone appears inactive.	<ol style="list-style-type: none"> 1. Check the I.S. telephone panel. 2. Check the ac fuse F4 at the Model 263 IBU. 3. Ensure there is no wiring open in the connecting cable or at the I.S. telephone.

 **CAUTION** 

Any field repairs on the intrinsically-safe design of the phone are strictly prohibited. Any such change will void ALL hazardous approvals. Please contact the GAI-Tronics Field Service Department at 800-492-1212 inside the USA or 610-777-1374 outside the USA for the Regional Service Center closest to you.

Lightning Protection

Telephone lines are susceptible to lightning strikes and must be properly protected and maintained. On-premise line protection is usually provided at the building entrance by the responsible telephone company when it is installed. This protection is often neglected after installation.

Degradation of conventional protection, such as carbon blocks or gas discharge types, will occur with each lightning strike. To ensure safe operation, protective elements should be replaced frequently and checked for proper connection and grounding. Gas discharge types are by far the most robust, cost-effective means of protection.

The registered I.S. equipment meets all isolation and safety requirements of FCC, Part 68, DOC CS-03, UL 913, and CSA C22.2-No. 157. However, lightning strikes are not predictable or considered to be a condition of fault likely to occur in practice as defined by the guidelines for intrinsic safety. Therefore, it is imperative that the user employ and maintain a proper lightning protection scheme. This is true for all hazardous area equipment and all telecommunications equipment subject to lightning.

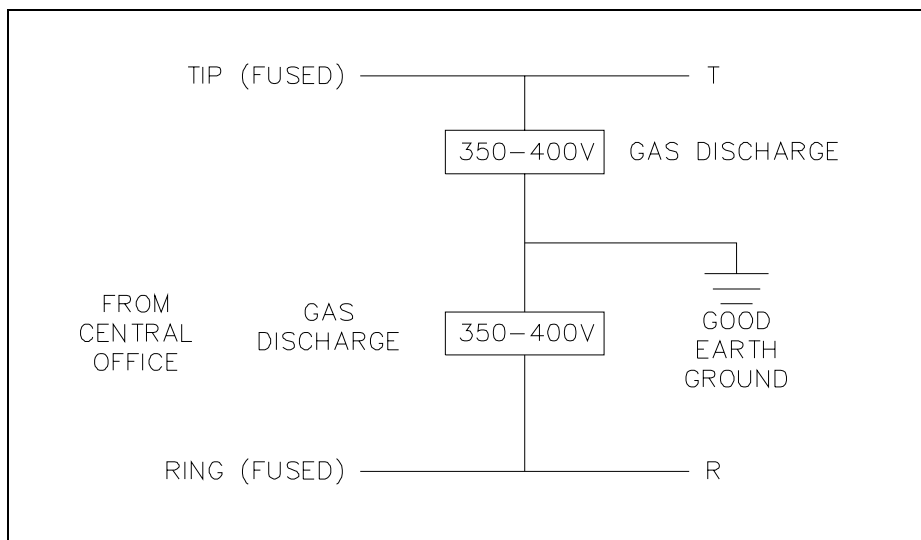


Figure 4. Example of a lightning protection design

Specifications

General/Environmental

Location (Model 263 IBU)	Ordinary (non-classified) indoor/outdoor
FCC Registration Number	ADGUSA-65066-TE-E
Ringer Equivalence Number (REN).....	0.4B
IC Certification Number (Canada)	822 4541 A
Load number (LN) (Canada).....	14
Connecting method (Canada).....	CA11A
Operating temperature range.....	-40° F to +140° F (-40° C to +60° C)
Relative humidity	95% (non-condensing) maximum
Maximum safe wiring distance between IBU and I.S. telephone	
Standard wire types	1 mile
Using GTC 60059-001 conductor	1.5 miles
Using GTC 60021-301 conductor	1.5 miles

Wiring

Construction.....	Twisted pair
*Type.....	Shielded
Conductor size (minimum)	24 AWG
Wiring loop resistance (maximum).....	275 ohms
Wiring capacitance (maximum).....	0.316 uF

*Shielded cable is required where multiple I.S. telephone wires are routed together.

Approvals

When connected according with Pub. 42004-380, Control Drawing 73242:

North America.....	Div. 1, Class I, Groups A, B, C, and D; Class II, Groups E, F, and G; Class III; Div. 2 (same Classes and Groups as Div. 1)
--------------------	---

Model 263 Isolation Barrier Unit

Electrical /Acoustical

Telephone Network Interface..... (2-wire)..... BELL Pub. 61100 Compatible
 (4-wire)..... See 4-wire option

AC power input..... Voltage (selectable) 90-132 V
 180-240 V

Frequency 47-63 Hz

Current 0.5 amps (maximum)

Ringer pitch adjust 1 kHz - 8 kHz (nominal)

Intrinsically safe Interface

Voltage (maximum) 8 volts

Resistance (minimum) 66 ohms

Current limited (maximum)..... 136 mA

Indicators

I.S. Loop Current..... I.S. LOOP (GRN)

I.S. Lock Detect..... I.S. LOCK (GRN)

Telephone Line Loop Current..... TELCO (YEL)

Hook HOOK (YEL)

Mechanical

Housing construction..... Glass-reinforced polyester

Housing dimensions 9.39 W × 13.16 H × 7.46 D inches; (238.5 × 334.3 × 189.5 mm)

Enclosure rating (UL)..... Type 3R (rainproof)

Weight 8.5 lbs. (3.86 kg)

Model 263 IBU 4-Wire Option Interface

Receive (TB2-1, 2)..... Dry (No dc)

Signal Level..... 0 dBm (nominal)
 +3 dBm (maximum)

Transmit (TB2-3, 4) Wet

DC Loop Current 20 mA-70 mA

Signal Level..... 0 dBm (nominal)

Ring Voltage Input..... 40 V-150 Vrms

Model 262-001 Indoor /Model 272-001 Outdoor I.S. Telephones

Electrical /Acoustical

Electrical specifications (nominal)	12 V, 12 mA
Ringer performance (typical)	98 dB @ 10 feet
Frequency (adjustable at the IBU)	1 kHz to 8 kHz (typical)
Ring signal loss (18 AWG)	-4 dB/mile
Signaling	DTMF
Transmission path (2-conductor)	Full duplex
Microphone	Dynamic noise-canceling
Earpiece	Hearing aid compatible
Output (0 dBm @ IBU TELCO Line)	105 dB SPL @ 1 kHz
Audio signal loss (18 AWG)	-1.3 dB/mile

NOTE: Must be connected in accordance with Pub. 42004-380, Control Drawing 73242.

Mechanical

Housing construction..... Glass-reinforced Polyester

Housing dimensions

Model 262-001	8.02 W × 9.52 H × 6.86 D inches; (203.7 × 241.8 × 174.2 mm) including handset; 3.86 D (98 mm), without handset
Model 272-001	9.39 W × 13.16 H × 7.46 D inches; (238.5 × 334.3 × 189.5 mm)

Enclosure rating (UL)

Model 262-001	Type 12
Model 272-001	Type 3R (rainproof)

Weight

Model 262-001	5.0 lbs. (2.27 kg)
Model 272-001	10.0 lbs. (4.53 kg)

Approvals

When connected in accordance with Pub. 42004-380, Control Drawing 73242:

UL/cUL.....	Class I, Div. 1, Groups A, B, C, and D; Class II, Div. 1, Groups E, F, and G; Class III;
-------------	---

Warranty

Equipment. GAI-Tronics warrants for a period of one (1) year from the date of shipment, that any GAI-Tronics equipment supplied hereunder shall be free of defects in material and workmanship, shall comply with the then-current product specifications and product literature, and if applicable, shall be fit for the purpose specified in the agreed-upon quotation or proposal document. If (a) Seller's goods prove to be defective in workmanship and/or material under normal and proper usage, or unfit for the purpose specified and agreed upon, and (b) Buyer's claim is made within the warranty period set forth above, Buyer may return such goods to GAI-Tronics' nearest depot repair facility, freight prepaid, at which time they will be repaired or replaced, at Seller's option, without charge to Buyer. Repair or replacement shall be Buyer's sole and exclusive remedy. The warranty period on any repaired or replacement equipment shall be the greater of the ninety (90) day repair warranty or one (1) year from the date the original equipment was shipped. In no event shall GAI-Tronics warranty obligations with respect to equipment exceed 100% of the total cost of the equipment supplied hereunder. Buyer may also be entitled to the manufacturer's warranty on any third-party goods supplied by GAI-Tronics hereunder. The applicability of any such third-party warranty will be determined by GAI-Tronics.

Services. Any services GAI-Tronics provides hereunder, whether directly or through subcontractors, shall be performed in accordance with the standard of care with which such services are normally provided in the industry. If the services fail to meet the applicable industry standard, GAI-Tronics will re-perform such services at no cost to buyer to correct said deficiency to Company's satisfaction provided any and all issues are identified prior to the demobilization of the Contractor's personnel from the work site. Re-performance of services shall be Buyer's sole and exclusive remedy, and in no event shall GAI-Tronics warranty obligations with respect to services exceed 100% of the total cost of the services provided hereunder.

Warranty Periods. Every claim by Buyer alleging a defect in the goods and/or services provided hereunder shall be deemed waived unless such claim is made in writing within the applicable warranty periods as set forth above. Provided, however, that if the defect complained of is latent and not discoverable within the above warranty periods, every claim arising on account of such latent defect shall be deemed waived unless it is made in writing within a reasonable time after such latent defect is or should have been discovered by Buyer.

Limitations / Exclusions. The warranties herein shall not apply to, and GAI-Tronics shall not be responsible for, any damage to the goods or failure of the services supplied hereunder, to the extent caused by Buyer's neglect, failure to follow operational and maintenance procedures provided with the equipment, or the use of technicians not specifically authorized by GAI-Tronics to maintain or service the equipment. **THE WARRANTIES AND REMEDIES CONTAINED HEREIN ARE IN LIEU OF AND EXCLUDE ALL OTHER WARRANTIES AND REMEDIES, WHETHER EXPRESS OR IMPLIED BY OPERATION OF LAW OR OTHERWISE, INCLUDING ANY WARRANTIES OF MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE.**

Return Policy

If the equipment requires service, contact your Regional Service Center for a return authorization number (RA#). Equipment should be shipped prepaid to GAI-Tronics with a return authorization number and a purchase order number. If the equipment is under warranty, repairs or a replacement will be made in accordance with the warranty policy set forth above. Please include a written explanation of all defects to assist our technicians in their troubleshooting efforts.

Call 800-492-1212 (inside the USA) or 610-777-1374 (outside the USA) for help identifying the Regional Service Center closest to you.